



SHEET METAL SUPPLY LTD.

262 S. Shaddle Ave.
Mundelein, IL 60060

P: 847.478.8500

F: 847.478.9500

Installation Procedure for MegaLock 2

1. Run the roof membrane over the nailer and down the vertical wall. Extend the membrane approximately 1/2" before the nailer wall joint.
2. Prepare both the horizontal flange of the base as well as the receiving membrane surface to assure secure bond of non-curing butyl sealant (3/8" bead). See Diagram A. **NOTE: Base is shown upside down for application of sealant.**
3. Following application of the non-curing sealant place the base in position atop the outside edge of the perimeter nailer.

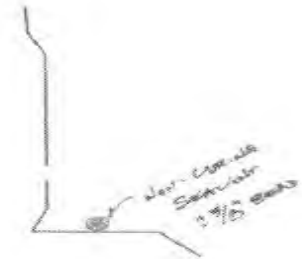


Diagram A

Secure the base to the nailer by installing a threaded fastener in every hole on the vertical portion of the base.

NOTE: Within 10', in either direction of a corner condition double the fastening pattern by equally spacing between pre-punched fastener holes.

4. With the base properly installed, remove the protective film from the face and splice plate over the base in the position where two face pieces about. Next, place the 10' section of face atop the base and firmly push the outer edge of the top of the face down. The bottom of the face will snap under the joggle of the base. At this point, the face is correctly in place. Leave a 3/8" gap between the face pieces over the splice plate.
5. The correctly installed MegaLock 2 perimeter will look like Diagram B.
6. Should you have any questions about the installation of MegaLock 2, please call SHEET METAL SUPPLY LTD. at 847-478-8500.



Diagram B

Thank you for choosing one of the finest wind tested perimeter metal products for your project.